

User's manual

Welding Machine MMA 20–200 A 63318



Illustration similar, may vary depending on model

Read and follow the operating instructions and safety information before using for the first time.

Technical changes reserved!

Illustrations, functional steps, and technical data may deviate insignificantly due to continuous further developments.

Updating the documentation

If you have suggestions for improvement or have found any irregularities, please contact us.



The information contained in this document may alter at any time without prior notice. No part of this document may be copied or otherwise duplicated without prior written consent. All rights reserved. WilTec Wildanger Technik GmbH cannot be held liable for any possible mistakes in this operating manual, nor in the diagrams and illustrations shown.

Although WilTec Wildanger Technik GmbH has made every possible effort to ensure that this operating manual is complete, accurate, and up-to-date, errors cannot be ruled out entirely.

If you have found an error or wish to suggest an improvement, we look forward to hearing from you.

Send us an e-mail to:

service@wiltec.info

or use our contact form:

<https://www.wiltec.de/contacts/>

The most recent version of this manual in several languages can be found in our online shop:

<https://www.wiltec.de/docsearch>

Our postal address is:

WilTec Wildanger Technik GmbH
Königsbenden 12
52249 Eschweiler – Germany

To return your goods for exchange, repair, or other purposes, please use the following address. Attention! To allow for a trouble-free complaint or return, it is important to contact our customer service team before returning your goods.

Retourenabteilung
WilTec Wildanger Technik GmbH
Königsbenden 28
52249 Eschweiler – Germany

E-mail: **service@wiltec.info**

Tel: +49 2403 55592-0

Fax: +49 2403 55592-15



Introduction

Thank you for choosing to purchase this quality product. To minimise the risk of injury, we ask you to always take some basic safety precautions when using this product. Please read this operating manual carefully and make sure that you understand it. Keep these operation instructions in a safe place.

Safety instructions

Welding is dangerous and might harm you or others. Therefore, you must protect yourself appropriately when welding. Refer to the user's safety rules in accordance with the manufacturer's safety precautions.



- Before operating the machine, you must be trained professionally.
- Use state (national) safety agency-approved industrial safety welding material.
- The user must be qualified and have a valid metal welding certificate (OFC).



- Avoid electric shocks. They can lead to severe injuries or even death.
- Install the earth equipment according to the application criteria.
- Never touch live components if wearing wet gloves/clothes or if having skin contact.
- Make sure that you are insulated from the ground and workpiece.
- Make sure that you have a secure working position.
- Before maintaining or repairing the welding machine, disconnect it from the mains.



- Breathing in smoke or gas can be harmful to your health.
- Therefore, keep your head away from smoke and gas to avoid breathing in of welding exhaust fumes.
- When welding, ensure a good ventilation of the working zone by using extraction or ventilation units.



- Welding arc radiation can cause eye damages and skin burns. Therefore, to protect your eyes and body, wear a suitable welding helmet.
- Use appropriate protective screens to protect persons standing nearby.



- Any improper operation can provoke a fire or an explosion.
- Welding sparks can cause fire. Therefore, make sure that no flammable material is nearby and pay attention to possible fire dangers.
- Have a fire-extinguisher at hand and have a trained person use it in case.
- Welding air-tight containers is forbidden.



- The welding machine can only be used for welding. Any improper use (e.g., defrosting pipes, recharging batteries, or heating) is strictly forbidden.



- Do not touch hot workpieces with bare hands; otherwise, you will be severely burnt.
- During permanent use of the welding machine, cooling is necessary.



- Magnetic fields impair pacemakers.
- Persons equipped with pacemakers should leave the immediate welding zone before having consulted a doctor.



- Moving parts can provoke injuries.
- Therefore, keep hands, hair, and tools away from moving parts such as the fan to avoid injuries or damages to the machine.
- All doors, panels, covers, and other protective devices must be closed during operation.

Working environment

- Welding should be performed within a dry environment.
- The temperature within the working zone should be comprised between -10 °C and 40 °C.
- Avoid welding outdoors, unless you be protected from sunlight and rain. Always keep the machine dry and do not place it to a wet ground or in a puddle.
- Avoid welding in dusty areas or in areas with presence of corrosive chemical gases.
- Gas-shielded welding should be performed in a zone without a lot of draught.

Ventilation

During welding, there is presence of a heavy current; therefore, the natural draught cannot provide sufficient cooling. Ensure good ventilation via the ventilation slots of the machine. The minimum distance between the machine and all other objects within or near the working zone should be 30 cm. Good ventilation is vital for the normal performance and service life of the machine.

Welding

This welding machine is equipped with an overcurrent protection, overvoltage protection, and overheating protection. If the input voltage or output current is too high or the inner temperature of the machine gets too hot, the machine switches itself off automatically. When used too much (e.g., use with too high a tension), the machine might be damaged; take account of it.

Welding is forbidden with the machine being overcharged. Bear in mind to always respect the maximum load current (see corresponding duty cycle). Make sure that the welding current does not exceed the maximum load current. If the machine is overcharged, its service life can be reduced or it might even be damaged.

Overvoltage is forbidden. The tension range for the power supply of the machine is given in the “Welding parameters” chart (see below). The machine is equipped with an automatic tension compensation that keeps the tension range within the rated range. Should the input tension exceed the given value, the components of the machines might be damaged.

Sudden standstill might happen if the machine is in a protection cycle. In this case, restarting the machine is not necessary. Let the integrated fan running and lowering the inner temperature of the machine.

Description

This LCD-type MMA welding machine is a IGBT DC ARC welder. It is equipped with an LCD display where the welding method and parameters chosen can be adjusted directly. It provides functions such as hot start, choice of electrodes, VRD, lift WIG, etc. The user can choose depending on his or her own welding practice to achieve best results.

Advanced IGBT inverter technology


- The high frequency of the inverter considerably reduces the volume and weight of the welding machine.
- The considerable reduction of magnetic and resistance losses improves the welding performance and energy efficiency.
- The switching frequency is beyond the range of audibility; thus, there is nearly no noise pollution.

Leading control mode

- The advanced control technology, being suitable for different welding applications, improves the welding performance considerably.
- It can be largely used for welding with acid and basic electrodes.
- Simple arc ignition, less spatters, stable current, and good shaping

Control elements and description

Control panel

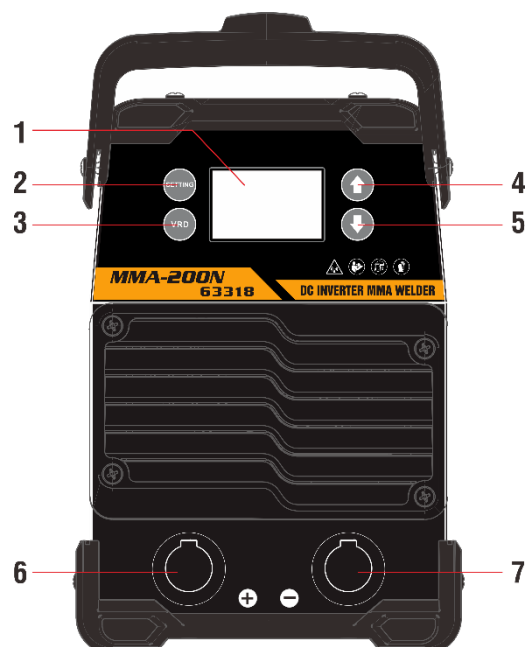


No	Name
1	LCD display
2	Adjustment of different functions
3	VRD on or off
4	Current increase button:



	Choose this button when the machine is in MMA or lift WIG mode.
5	Current reduction button: <ul style="list-style-type: none"> When the machine is in MMA or lift WIG mode, press the button once in order that the output current falls by 1 A. When you press the button longer, the output current falls automatically. When you press this button in "Hot Start" or "Arc Force" mode, the percentages fall.
6	Positive output connection: <ul style="list-style-type: none"> When the machine is in MMA or lift WIG mode, press the button once in order that the output current rises by 1 A. When you press the button longer, the output current rises automatically. When you press this button in "Hot Start" or "Arc Force" mode, the percentages rise
7	Negative output connection: When using rutile electrode rods, connect the electrode holder. When using basic electrode rods, connect the earth clamp.

LCD display

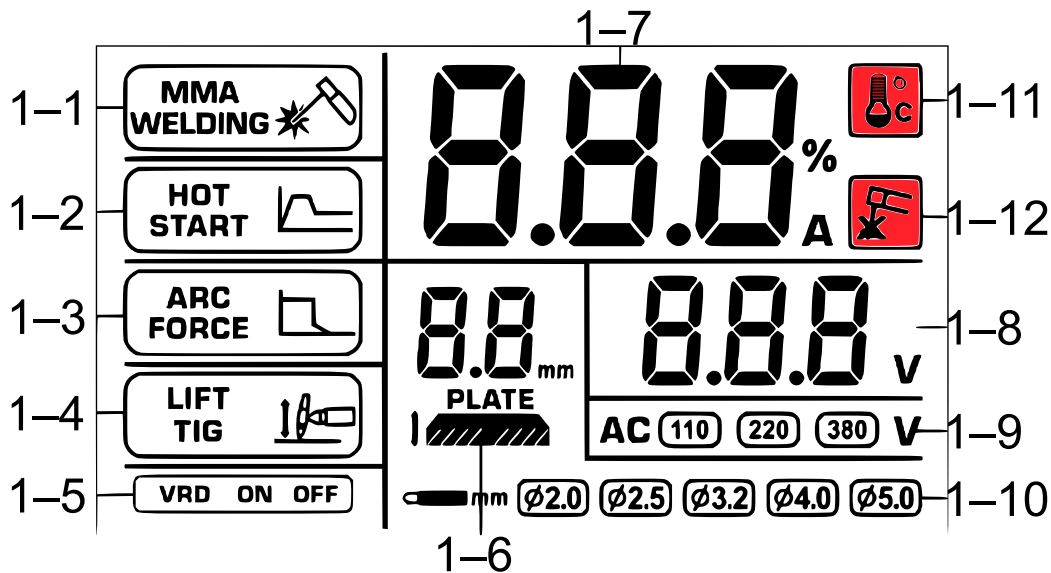

No	Name
1-1	MMA welding
1-2	Hot start
1-3	Arc force
1-4	Lift WIG
1-5	VRD
1-6	To choose the material thickness: Adjust using the buttons 4 and 5. The choice of material thickness of the piece is modified accordingly.
1-7	Display of welding current or percentage %
1-8	Display of output voltage, e.g., no-load voltage, welding voltage, or VRD voltage
1-9	Display of input voltage
1-10	Display of electrode diameter: The electrode diameter preset refer to the according current range. Modify the electrode diameter using the buttons 4 and 5. Pressing the buttons



	4 and 5 modifies the electrode diameter; the different welding currents display the corresponding electrode diameter.
1-11	Protection against excessive temperature
1-12	Anti-stick function: prevents the electrode from sticking to the piece

Technical specifications

Model name	MMA-200
Intake voltage (V)	1~220 V
Frequency (Hz)	50/60
Current (A)	20-200
No-load voltage (V)	68
Output voltage (V)	21-28
Relative operating cycle (%)	35
Isolation class	F
IP code	IP21S

Caution!

Diameter of electrodes (mm)	1.6-5
Recommended metal plate thickness (mm)	1.5-5


Installation and operation

Note!

- Only install the machine according to the steps below.
- Switch off the power supply before performing the electric connections.
- The IP code of the machine being IP21S, the machine must not be used in the rain.

Installation

1. Connect the power cable to the power supply.
2. Using a multimeter, check if the voltage value is comprised within an acceptable range.
3. Plug the electrode holder into the “+” connection of the front of the welding machine and tighten it clockwise.
4. Plug the cable plug into the “-” connection of the front of the welding machine and tighten it clockwise.
5. For safety reasons, an earth connection is required.

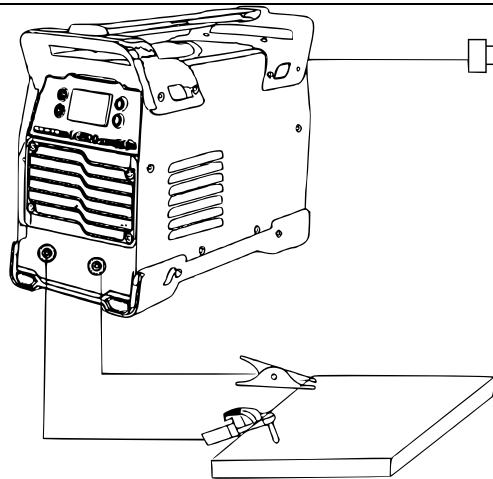

Operation

1. After installing the machine as described and switching the power switch on, the machine is started with the power LED lit and the fan running.
2. The welding current must be adjusted considering different factors, e.g., the material thickness of the piece or the diameter of the electrodes.
3. Clamp the electrode to the electrode holder and light the arc to begin welding. The LCD display might show the parameters when doing so,

Welding parameters

∅ Electrode (mm)	Recommended welding current (A)	Recommended welding tension (V)
1.0	20–60	20.8–22.4
1.6	44–84	21.76–23.36
2.0	60–100	22.4–24.0
2.5	80–120	23.2–24.8
3.2	108–148	23.32–24.92
4.0	140–180	24.6–27.2
5.0	180–220	27.2–28.8
6.0	220–260	28.8–30.4

Note! Please note that the parameters mostly apply for welding steel with low carbon content.

Maintenance



The following operation instructions require sufficient electrotechnical and extensive safety knowledge. The users must have a valid proof of qualification documenting their abilities and knowledge. Make sure that the input cable is disconnect of the device if disconnected from the mains before uncovering the welding machine.

- Check regularly if the inner circuit contacts are in a good condition (especially the plugs). Retighten any loose contact. If there is oxidation, remove it using sandpaper, then reconnect the contacts.
- Clean the dust with dry and clean pressurised air on a regular basis. Used within a highly smoky and dirty, the machine should be cleaned daily. The pressure of the pressurised air should not be too high lest small inner components not be damaged.



- Prevent rain, water, and damp from entering the filter of the machine. Should this happen anyhow, dry the device and check the insulation (including the insulation between the connection points and the insulation between the connection and case). The device can be re-used after you have ascertained that there are no further abnormal phenomena.
- Check on a regular basis if the insulation covers of all cables are in a good condition. If they are damaged, re-wrap or replace them.
- Store the device in its original packing and in a dry spot if will not be used for a long period.

Troubleshooting

Problem	Proposed solution
The device is switched on, yet the power LED is off, the fan does not work, and there is no welding performance.	<ol style="list-style-type: none"> 1. Check if the power switch is switched off. 2. Check for loose cables inside the machine. 3. Missing input power 4. Defective fan
The display is normal, the fan is working normally, yet there is no output current.	<ol style="list-style-type: none"> 1. Check if the inner cable is in good condition. 2. Check if the inner connections are in good condition. 3. Check if the power LED is lit. If not, there is a circuit problem.
The machine is switched on, yet the fan does not work nor is there any output current.	<ol style="list-style-type: none"> 1. Defective external power supply 2. Damage to the supply cable
The machine is switched on, welding works normally, yet there is a sudden activation of the protection switch.	<ol style="list-style-type: none"> 1. The input current is too high due to an electric leak. 2. IGBT (Insulated Gate Bipolar Transistor) or bridge damaged
The machine is switched on, yet the output current is too low during welding.	<ol style="list-style-type: none"> 1. Insufficient cable connection of the potentiometer 2. Potentiometer damaged 3. Error in the circuit
The electrode holder is getting very hot.	Nominal current of electrode holder beneath actual working current; replace with electrode holder with higher nominal current.
Excess of welding spatters during MMA welding.	Wrong output polarity; reverse polarity.

Regulations for waste disposal

The Waste Electrical and Electronic Equipment Directive (WEEE Directive, 2012/19/EU) of the EU was implemented in the German law related to electrical and electronic equipment and appliances.

All WilTec electric devices that fall under the WEEE directive are labelled with the symbol of a crossed-out wheeled rubbish bin. This symbol indicates that this electric device must not be disposed of with the domestic waste.

WilTec Technik GmbH is registered with the German registration authority EAR (Stiftung Elektro-Altgeräte Register) under the WEEE-registration number DE45283704.

Disposal of used electrical and electronic devices (intended for use in the countries of the European Union and other European countries with a separate waste collection system for these devices).

The symbol on the packaging or the product itself indicates that this product must not be treated as normal domestic waste but must be disposed of at a recycling collection station for electrical and electronic waste.

By disposing of this product correctly, you contribute to the protection of the environment and the health of your fellow people. Inappropriate disposal threatens the environment and health.



Material recycling helps to reduce the consumption of raw materials.

Additional information about the recycling of this product can be provided by your local commune, the municipal waste disposal facilities, or the store where you purchased the product.

Address:
WilTec Wildanger Technik GmbH
Königsbenden 12 / 28
52249 Eschweiler Germany

Important Note:

Reproduction and any commercial use (of parts) of this operating manual, requires a written permission of WilTec Wildanger Technik GmbH.